


Screw-On Wire Connectors



DIMENSIONS = INCHES

CAT. NO.	TYPE	COLOR	WIRE COMBINATIONS	MAX VOLTS	A	B	C	D	E	BOX/BAG QTY	CASE QTY	
HANGING BAG 25 PACK												
23271	P1	GRAY	MAX: 3 #20 & 2 #22 MIN: 1 #20 & 1 #22	300V	.150	.264	.339	.228	.598	25	1,250	
23272	P2	BLUE	MAX: 3 #18 & 2 #20 MIN: 3 #22	300V	.161	.276	.386	.232	.693	25	1,250	
23273	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	25	1,250	
23274	P4	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	25	1,250	
23276	P6	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	25	1,250	
BOXED 100 PACK												
23071	P1	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	100	15,000	
23072	P2	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	100	15,000	
23073	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	100	10,000	
23074	P4	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	100	6,000	
23076	P6	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	100	3,600	
BAGGED BULK PACK												
23171	P1	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	1,000	20,000	
23172	P2	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	1,000	10,000	
23173	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #20	600V	.197	.390	.480	.307	.862	500	10,000	
23174	P4	YELLOW	MAX: 1 #10 & 2 #14 & 1 #16 MIN: 3 #20	600V	.236	.441	.551	.311	.937	500	5,000	
23176	P6	RED	MAX: 3 #10 MIN: 3 #18	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	500	5,000	
BULK PAIL												
NEW	23179	P1	GRAY	MAX: 1 #14 & 1 #20 MIN: 2 #22	300V	.150	.264	.339	.228	.598	-	16,000
NEW	23180	P2	BLUE	MAX: 3 #16 MIN: 2 #22	300V	.161	.276	.386	.232	.693	-	11,000
NEW	23181	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #20	600V	.197	.390	.480	.307	.862	-	6,500
NEW	23182	P4	YELLOW	MAX: 1 #10 & 2 #14 & 1 #16 MIN: 3 #20	600V	.236	.441	.551	.311	.937	-	4,000
NEW	23183	P6	RED	MAX: 3 #10 MIN: 3 #18	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	-	3,000
SMALL JAR												
23373	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	350	11,200	
23374	P4	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	250	8,000	
23376	P6	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	150	4,800	
LARGE JAR												
23473	P3	ORANGE	MAX: 4 #16 & 1 #20 MIN: 1 #18 & 1 #22	600V	.197	.390	.480	.307	.862	900	10,800	
23474	P4	YELLOW	MAX: 1 #18 & 4 #14 MIN: 1 #18 & 1 #14	600V	.236	.441	.551	.311	.937	600	7,200	
23476	P6	RED	MAX: 3 #14 & 4 #16 MIN: 1 #10 & 1 #20	600V 1000V FIXTURES & SIGNS	.276	.504	.630	.350	1.047	400	4,800	

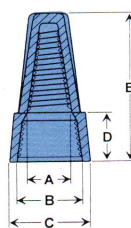

WIRE MANAGEMENT
Wire Connectors

D2